

New York State Department of Transportation

PIA Safety Flag NB23U4W002

By: Malav Shah

Flag Date: April 06, 2023

Superseding Information:

No Flags Superseded

Structure Information

BIN: 1065318

Feature Carried: 278I278IX2M23027

Feature Crossed: 6TH AVENUE

Orientation: 8 - NORTHWEST

Region: 11 - NEW YORK CITY

County: KINGS

Political Unit: City of NEW YORK

Approximate Year Built: 1962

Posted Load Matches Inventory : Yes

Bridge Load Posting (Tons) : Not Posted for Load

Primary Owner: New York State Department of Transportation

Primary Maintenance Responsibility: 12 - State - Subcontracted to another Party

Typical or Main Span Type: 3 - Steel, 02 - Stringer/Multi-Beam or Girder

This Bridge is not a Ramp

Number of Spans: 322

Verbal Notification Information

Person Notified: Heinz Joachim, P.E.

Date: April 06, 2023 3:00:00 PM

Of: NYSDOT Region 11

Signature Information

Signature: Malav Shah, P.E. 106620-1

Date: April 14, 2023

Reviewed By: Robert Kemp

Date: April 14, 2023

Attachments: 5

Flagged Elements**No Flagged Elements*****Flagged Condition Description***

Location: Span 103, Pier 102, Column C1 end face and Column C2 end face (51st street and 3rd avenue intersection)

Description: The junction box for the traffic light and attached to Column C1 is broken with exposed electric wires. This location is located at 3' above the ground on the sidewalk and can be accessed by walking. The area is temporarily secured with cones and caution tape. In a similar manner, the cover to the junction box attached to Column C2 is loose, but no wires are currently exposed.

Flag Photographs

Photo Number: 1

Photo Filename: SP103 C1 AT PIER 102 FRAMING PLAN.png

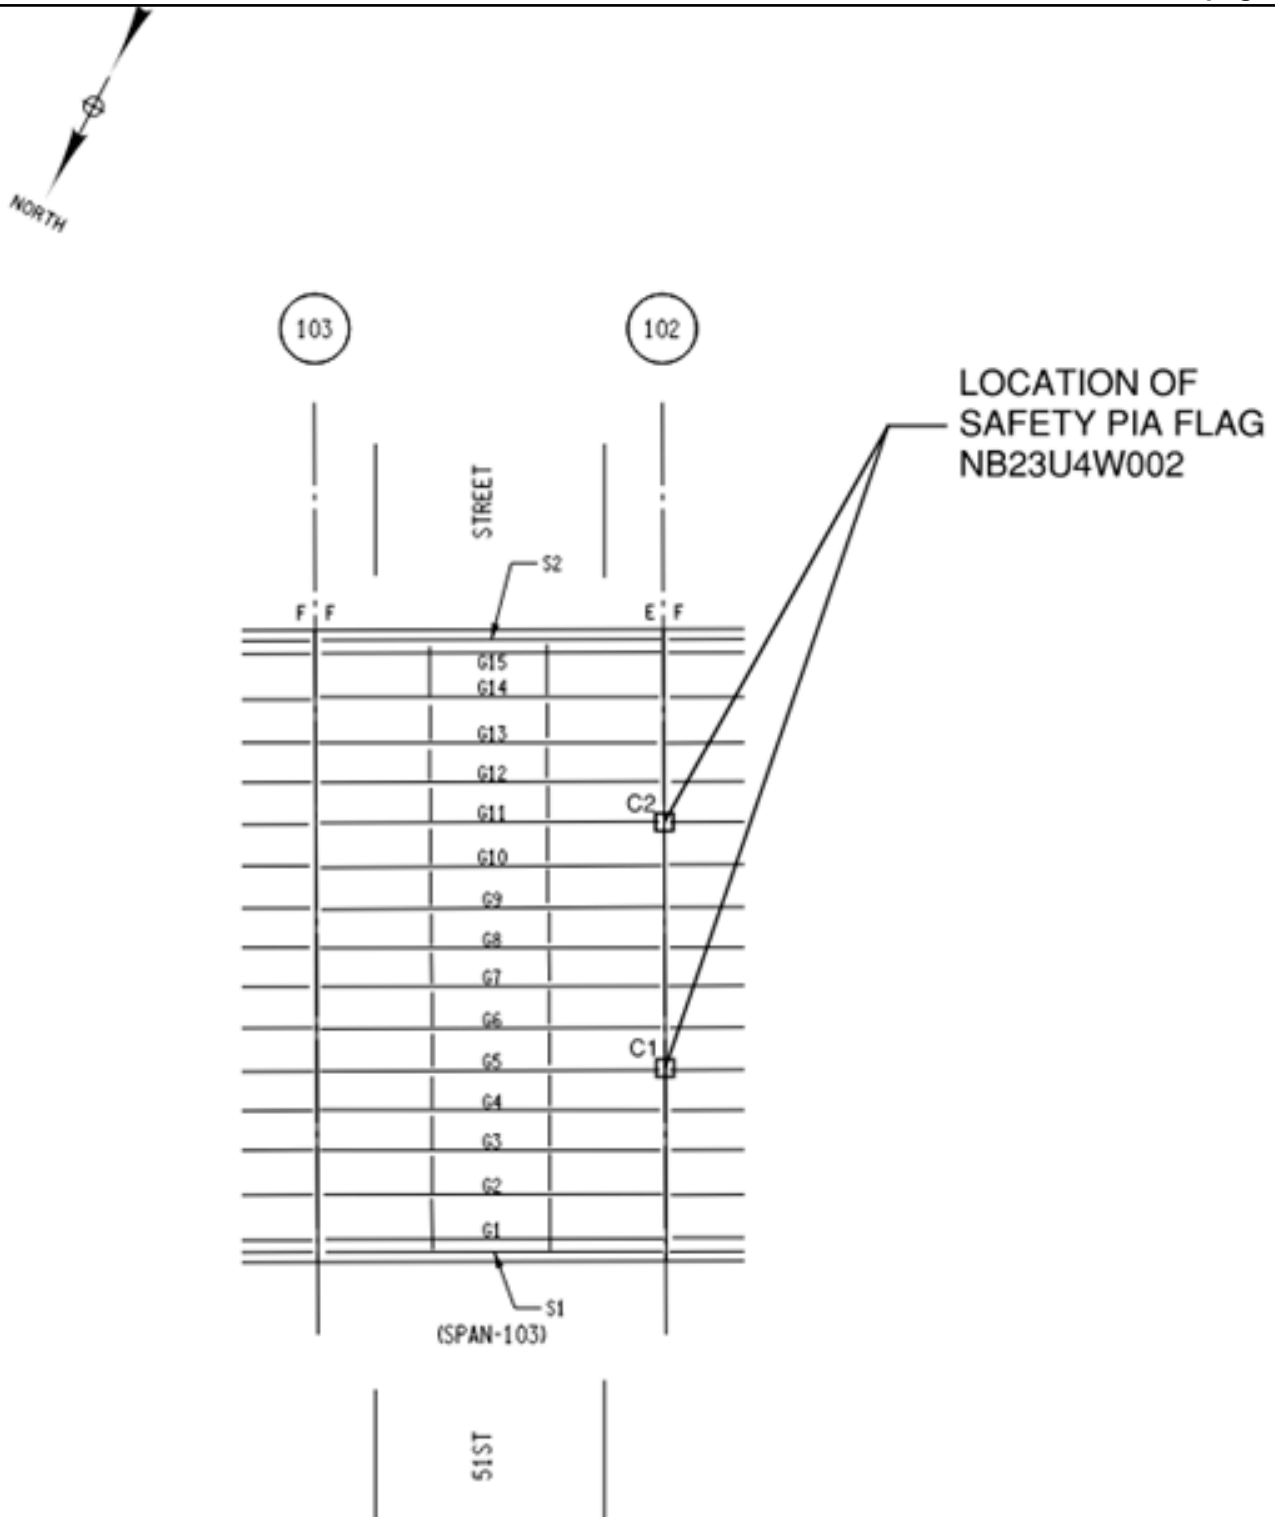
**Attachment Description: Safety PIA Flag Location**

Photo Number: 2

Photo Filename: SPAN 103 C1 at PIER 102.jpg



Attachment Description: General view of the flagged condition under Span 103, Column C1 at Pier 102. Looking Begin.

Photo Number: 3

Photo Filename: P4061976.JPG



Attachment Description: The sidewalk at the end face of Column C1 of Pier 102 under Span 103. The electrical junction box is broken with exposed wires. The area has been coned off with yellow caution tape. Looking Begin-Right.

Photo Number: 4

Photo Filename: P4061974.JPG



Attachment Description: The close up view of broken electrical junction box with exposed wires at Column C1, Pier 102, Span 103. Looking Begin.

Photo Number: 5

Photo Filename: P4061971.JPG



Attachment Description: The close up view of electrical junction box with loose cover at Column C2, Pier 102, Span 103. Looking Begin-Right.